

# Work Order ID 99235

Wednesday, April 03, 2013 3:37:21 PM

**\*99235\***

Page 1

Item ID: D212-664-201 TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 4/3/2013 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 4/19/2013 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan:

Date: *BOH3*

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D212-664-241	Rev D

100

0:00

**\*100\***

Mori Seiki

Mori Seiki CNC Lathe Large

MORI SEIKI CNC LATHE LARGE

Memo

0.00

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA114

2-Turn first side as per Folio FA114

3-Blend transition lines only, \*\*do not sand whole tube\*\*

FOLIO REV: *AD*

DWG REV: *D*

\*Use mill bastard file, brush file repeatedly with file card.

\*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

**\*110\***

QC

Quality Control

Memo

0.00

*mgm L*  
*1* *Ø* *KC*  
*13/04/05*

*Ph*  
*mgm L*  
*1* *Ø* *KC*  
*13/04/05*

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: AKL Date: 13/08/06QA Closed: AKL Date: 13/8/1

Work Order: <u>99235</u>	<b>DISPOSITION</b> Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>			
Part No. <u>D 212-664-201 TRN</u>		Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
NCR No. <u>13-2900</u>					

Root Cause		Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data		13/5/16	100	1	One cuff is 4.947" long (avg = 5.237")  R.C. Process (material)	GP 13/7/2	Acceptable. Cosmetic only. There is a lot of cuffs above the saddle & this should not be noticeable.	GP 13/7/2	JW 13-07-10	DAS 16 9-89  13/6/30
Equip/Tooling										
Operator										
Material	X									
Setup										
Other										
Process										
Supplier										
Training										
Unapproved										

## FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---

**Work Order ID 99235****\*99235\***

Page 2

Wednesday, April 03, 2013 3:37:21 PM

Item ID: D212-664-201TRN

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 4/3/2013 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 4/19/2013 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start **\*NR1\***

QC: Date: SPC (Y/N): Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

**\*120\***

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA114

2-Blend transition lines only, \*\*do not sand whole tube\*\*:

\*Use mill bastard file, brush file repeatedly with file card.

\*Do not use sandpaper coarser than 320 grit.

FOLIO REV: ADDWG REV: D

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

130

QC1- Inspect dimensions to dimension sheet

0.00

**\*130\***

QC

Memo

0.00

Quality Control

1  $\phi$

mmml  
13/04/05

1  $\phi$

mmml  
13/04/05

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		
<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other		

**Work Order ID 99235**

Wednesday, April 03, 2013 3:37:21 PM

**\*99235\***

Page 3

Item ID: D212-664-201TRN

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 4/3/2013 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 4/19/2013 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

**\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop

**\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

140

QC8- Inspect parts - second check

0.00

**\*140\***

QC

Memo

0.00

Quality Control

TW 13-07-10

145

0.00

**\*145\***

Crosstubes

Memo

0.00

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

LB 13-07-23

150

0.00

**\*150\***

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

1 Ø  
mm  
13/07/25

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY										
<b>Landing Gear</b>			<b>General</b>							
<input type="checkbox"/> Bending	<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Cracks	<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Cuffs	<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Wave/Twist in Tube
<input type="checkbox"/> Bend	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Burrs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Countersink	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Drawing	<input type="checkbox"/> Finish	<input type="checkbox"/> Folio
<input type="checkbox"/> Grain	<input type="checkbox"/> Hardware	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Misread	<input type="checkbox"/> Offset	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ovalized	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Part Moved	<input type="checkbox"/> Positioned Wrong	<input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced	<input type="checkbox"/> Temperature/Cure	<input type="checkbox"/> Weld	<input type="checkbox"/> Wrong Stock Pulled
<input type="checkbox"/> Other										

# Work Order ID 99235

Wednesday, April 03, 2013 3:37:21 PM

**\*99235\***

Page 4

Item ID: D212-664-201TRN

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Turning Detail

Start Date: 4/3/2013 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 4/19/2013 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start **\*NR1\***

QC: Date: SPC (Y/N): Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

160

QC5- Inspect part completeness to step on W/O

0.00

**\*160\***

QC

Memo

0.00

Quality Control

DA  
05  
8-89 13-07-25

170

Packaging

0.00

**\*170\***

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack  
Location: LG

Rm 13-04-25

180

QC21- Final Inspection - Work Order Release

0.00

**\*180\***

QC

Memo

0.00

Quality Control

MLJ 13-07-30  
MLJ 13-07-29

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div>Rework <input type="checkbox"/></div> <div>Skid-tube <input type="checkbox"/></div> <div>Crosstube <input type="checkbox"/></div> <div>Water Jet <input type="checkbox"/></div> <div>Engineering <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Scrap <input type="checkbox"/></div> <div>Machining <input type="checkbox"/></div> <div>Small Fab <input type="checkbox"/></div> <div>Prod. Eng. Coord. <input type="checkbox"/></div> <div>Quality <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Use-as-is <input type="checkbox"/></div> <div>Thermoforming <input type="checkbox"/></div> <div>Finishing <input type="checkbox"/></div> <div>Rec/Store/Packaging <input type="checkbox"/></div> <div>Other <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Work Order Update <input type="checkbox"/></div> <div>Large Fab <input type="checkbox"/></div> <div>Composite <input type="checkbox"/></div> <div>Supplier <input type="checkbox"/></div> </div>	
--	---	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
---	---	---

☐ Ovalized  
☐ Over/Under tolerance  
☐ Part Incorrect  
☐ Part Lost/Missing  
☐ Part Moved  
☐ Positioned Wrong  
☐ Power Loss/Surge

☐ Pressure/Forced  
☐ Temperature/Cure  
☐ Weld  
☐ Wrong Stock Pulled  
☐ Other



# Picklist Print

Wednesday, April 03, 2013 3:37:26 PM

Page 1

Work Order ID: 99235

\*99235\*

Parent Item: D212-664-201TRN

\*D212-664-201TRN\*

Parent Item Name: Crosstube Turning Detail

Start Date: 4/3/2013

Required Date: 4/19/2013

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec  
IPP Rev B 08.04.02 Removed polish EC verified DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6006-129		Manufactured	No			120	Each	24.0000	1	1			

\*D6006-129\*

Crosstube Material

\*\*

Location

Loc Qty

Loc Code

LG015

24

69838

2

75633

22

REC 13/04/05

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions  <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
---	---	--

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b> <i>9233</i>
<b>Description:</b> Crosstube Assembly (205/212 High Aft)	<b>Part Number:</b> D212-664-241
<b>Inspection Dwg:</b> D212-664-241 <b>Rev:</b> D	<b>Page 1 of 2</b>

### FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	<i>.200</i>	<i>/</i>		<i>vern</i>	<i>CWC-08</i>
	R0.063	+/-0.010	<i>.063</i>	<i>/</i>		<i>RG</i>	
	2.990	+0.005/-0.000	<i>2.991</i>	<i>/</i>		<i>mic</i>	<i>CWC-04</i>
	5.237	+/-0.030	<i>4.945</i>		<i>/</i>	<i>vern</i>	
	2.600	+0.005/-0.000	<i>2.603</i>	<i>/</i>		<i>mic</i>	<i>CWC-04</i>
	2.686	+0.005/-0.000	<i>2.688</i>	<i>/</i>		<i>↓</i>	
	2.770	+0.005/-0.000	<i>2.775</i>	<i>/</i>			
	2.854	+0.005/-0.000	<i>2.859</i>	<i>/</i>			
	2.938	+0.005/-0.000	<i>2.943</i>	<i>/</i>		<i>↓</i>	
	3.021	+0.005/-0.000	<i>3.022</i>	<i>/</i>		<i>mic</i>	<i>CWC-05</i>
	3.133	+0.005/-0.000	<i>3.134</i>	<i>/</i>		<i>↓</i>	
	3.179	+0.005/-0.000	<i>3.183</i>	<i>/</i>		<i>↓</i>	
SIDE B	0.200	+/-0.010	<i>.200</i>	<i>/</i>		<i>vern</i>	<i>CWC-08</i>
	R0.063	+/-0.010	<i>.063</i>	<i>/</i>		<i>RG</i>	
	2.990	+0.005/-0.000	<i>2.995</i>	<i>/</i>		<i>mic</i>	<i>CWC-04</i>
	5.237	+/-0.030	<i>5.237</i>	<i>/</i>		<i>vern</i>	
	2.600	+0.005/-0.000	<i>2.605</i>	<i>/</i>		<i>mic</i>	<i>CWC-04</i>
	2.686	+0.005/-0.000	<i>2.687</i>	<i>/</i>		<i>↓</i>	
	2.770	+0.005/-0.000	<i>2.773</i>	<i>/</i>			
	2.854	+0.005/-0.000	<i>2.858</i>	<i>/</i>			
	2.938	+0.005/-0.000	<i>2.943</i>	<i>/</i>		<i>↓</i>	
	3.021	+0.005/-0.000	<i>3.022</i>	<i>/</i>		<i>mic</i>	<i>CWC-05</i>
	3.133	+0.005/-0.000	<i>3.134</i>	<i>/</i>		<i>↓</i>	
	3.179	+0.005/-0.000	<i>3.183</i>	<i>/</i>		<i>↓</i>	
	124.362	+/-0.020	<i>124.365</i>	<i>/</i>		<i>TAPE</i>	<i>LG-15</i>

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_


QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div> Rework <input type="checkbox"/>  Scrap <input type="checkbox"/>  Use-as-is <input type="checkbox"/>  Work Order Update <input type="checkbox"/> </div> <div> Skid-tube <input type="checkbox"/>  Machining <input type="checkbox"/>  Thermoforming <input type="checkbox"/>  Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/>  Small Fab <input type="checkbox"/>  Finishing <input type="checkbox"/>  Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/>  Prod. Eng. Coord. <input type="checkbox"/>  Rec/Store/Packaging <input type="checkbox"/>  Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/>  Quality <input type="checkbox"/>  Other <input type="checkbox"/> </div> </div>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-around;"> <div> Skid-tube <input type="checkbox"/>  Machining <input type="checkbox"/>  Thermoforming <input type="checkbox"/>  Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/>  Small Fab <input type="checkbox"/>  Finishing <input type="checkbox"/>  Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/>  Prod. Eng. Coord. <input type="checkbox"/>  Rec/Store/Packaging <input type="checkbox"/>  Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/>  Quality <input type="checkbox"/>  Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY										
<b>Landing Gear</b>			<b>General</b>							
<input type="checkbox"/> Bending	<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> Cracks	<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Cuffs	<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Wave/Twist in Tube
<input type="checkbox"/> Bend	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Burrs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Countersink	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Drawing	<input type="checkbox"/> Finish	<input type="checkbox"/> Folio
<input type="checkbox"/> Grain	<input type="checkbox"/> Hardware	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Misread	<input type="checkbox"/> Offset	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Ovalized	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Part Moved	<input type="checkbox"/> Positioned Wrong	<input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced	<input type="checkbox"/> Temperature/Cure	<input type="checkbox"/> Weld	<input type="checkbox"/> Wrong Stock Pulled
<input type="checkbox"/> Other										

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b> 99233
<b>Description:</b> Crosstube Assembly (205/212 High Aft)	<b>Part Number:</b> D212-664-241
<b>Inspection Dwg:</b> D212-664-241 Rev: D	<b>Page 2 of 2</b>

### WALL THICKNESS MEASUREMENT

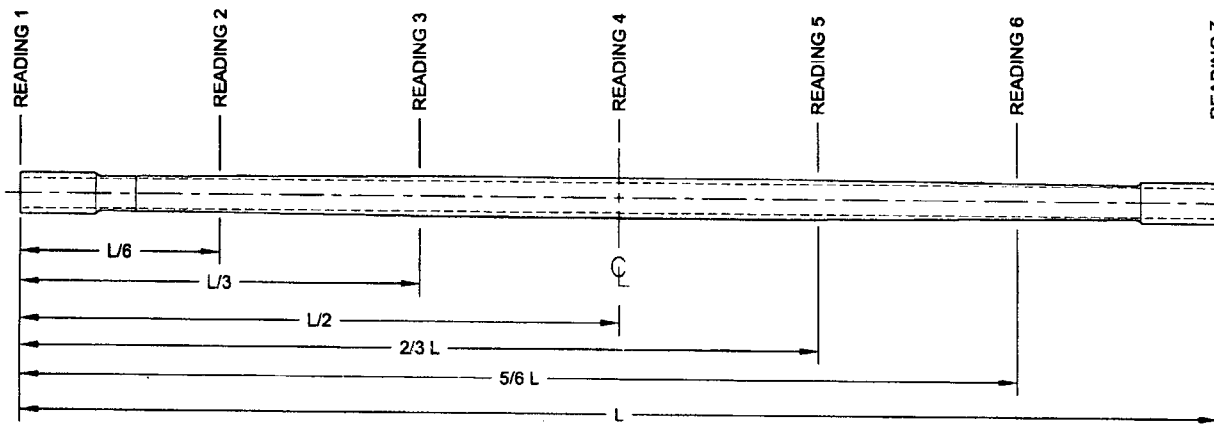

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation $\Delta w$ (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L = 0"	.379	.386	.401	.397	.022	0.062"
READING 2 L = 15	.251	.267	.276	.264	.025	
READING 3 L = 30	.361	.400	.401	.362	.040	
READING 4 L = 62	.520	.522	.508	.509	.014	
READING 5 L = 30	.378	.393	.383	.370	.023	
READING 6 L = 15	.256	.282	.264	.244	.020	
READING 7 L = cuff	.406	.388	.374	.391	.032	

#### Calibration Result

Actual Block Thickness: 100 - 750

SITESCAN 250 Measured Thickness: 100 - 750

<b>Measured by:</b> <i>mm</i>	<b>Audited by:</b> <i>TJ</i>	<b>Preliminary Approval:</b>
<b>Date:</b> 13/04/06	<b>Date:</b> 13-07-10	<b>Date:</b>

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-201)	KJ/JLM	
B	06.03.09	Tolerance for 5.237 was +/-0.001	KJ/JLM	
C	07.05.08	Dwg Rev. updated	KJ/JLM	
D	10.08.03	Dimension 124.362 was 124.36	KJ	
E	12.06.04	Wall thickness form added	KJ	<i>[Signature]</i>

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  <div style="display: flex; justify-content: space-around;"> <div>Rework <input type="checkbox"/></div> <div>Skid-tube <input type="checkbox"/></div> <div>Crosstube <input type="checkbox"/></div> <div>Water Jet <input type="checkbox"/></div> <div>Engineering <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Scrap <input type="checkbox"/></div> <div>Machining <input type="checkbox"/></div> <div>Small Fab <input type="checkbox"/></div> <div>Prod. Eng. Coord. <input type="checkbox"/></div> <div>Quality <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Use-as-is <input type="checkbox"/></div> <div>Thermoforming <input type="checkbox"/></div> <div>Finishing <input type="checkbox"/></div> <div>Rec/Store/Packaging <input type="checkbox"/></div> <div>Other <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Work Order Update <input type="checkbox"/></div> <div>Large Fab <input type="checkbox"/></div> <div>Composite <input type="checkbox"/></div> <div>Supplier <input type="checkbox"/></div> </div>	
--	---	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b>  <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b>  <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
---	---	---	---

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2	2	D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6	4	4	MS21920-28	CLAMP (OR MS21920-30)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6006-129  
FINISHED LENGTH = 124.362±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF  
USING VIBRATING STYLUS.
- 7) WEIGHT: D212-664-241 = 44.2 lbs (PER IIN-D212-664)  
D212-664-241B = 44.2 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING  
IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE  
OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS  
AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D2940-1  
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE  
SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE  
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR  
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND  
MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT  
HAS NOT BOTTOMED-OUT AFTER TORQUING.

600 #11-614  
11.08.25  
**UNDER REVIEW**  
11/06/13

**DEO ATTACHED**

**RELEASED**  
2009-10-29


D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-241	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	





99235

- 12 13 15
- D2940-1 SUPPORT
- MS21920-28 CLAMP, 2X
- D3595-063-530 RUBBER CUSHION, 2X
- 2 PL

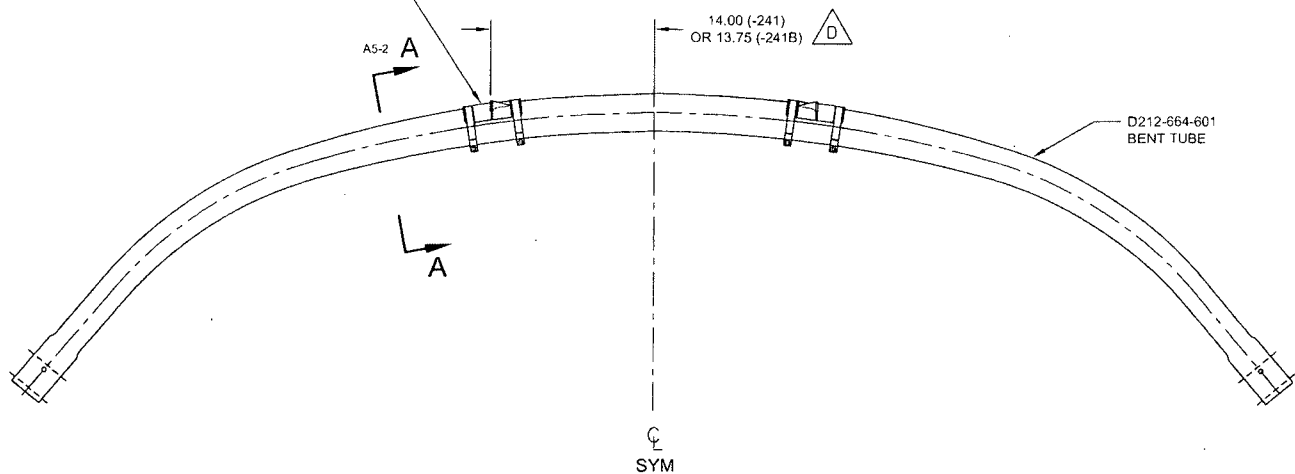


**D212-664-241/-241B**  
**ASSEMBLY DETAIL**

600#11-614  
11.07.26  
**UNDER REVIEW**  
4/12/06.13

**DEO ATTACHED**

**RELEASED**  
2009-10-28

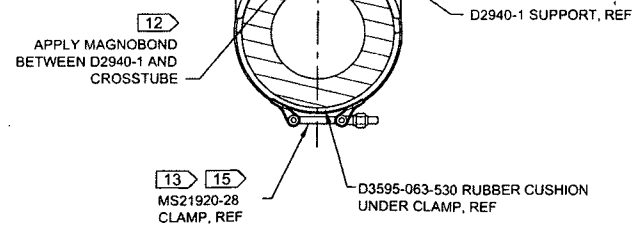


**SECTION A-A** D6-2  
**SCALE 4X**

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	S	D212-664-241	SHEET 2 OF 4
APPROVED	10	TITLE	SCALE
DE APPR.	11	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			



99235

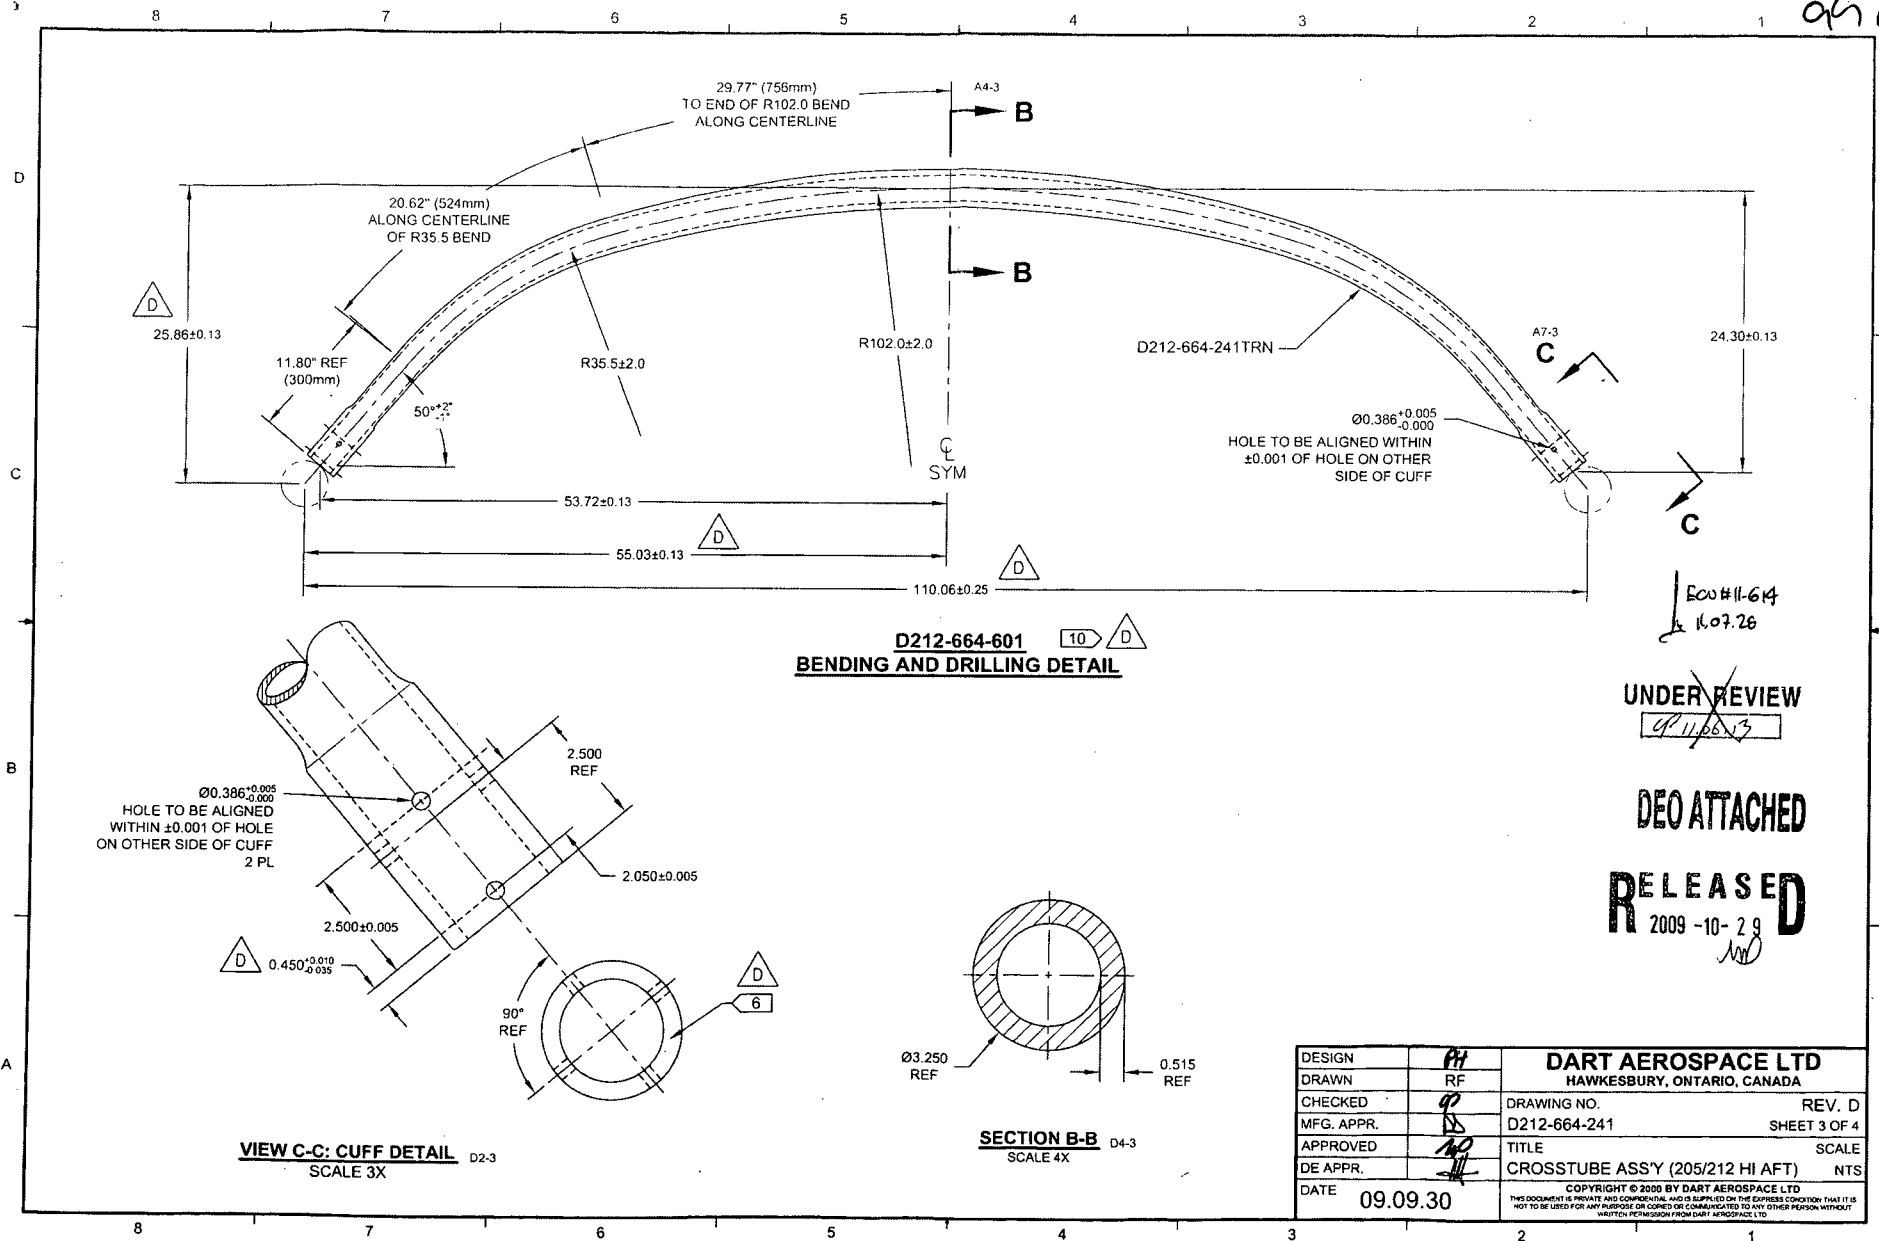

ECO #11-614  
11.07.26

UNDER REVIEW  
9/11/06/13

DEO ATTACHED

RELEASED  
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	JP	DRAWING NO.	REV. D
MFG. APPR.	JP	D212-664-241	SHEET 3 OF 4
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			




99235

R100.0 TRANSITION  
BETWEEN TAPERED  
SECTIONS


R100.0 TRANSITION  
BETWEEN TAPERED  
SECTIONS

0.515 WALL  
STOCK, REF

SEE DETAIL D

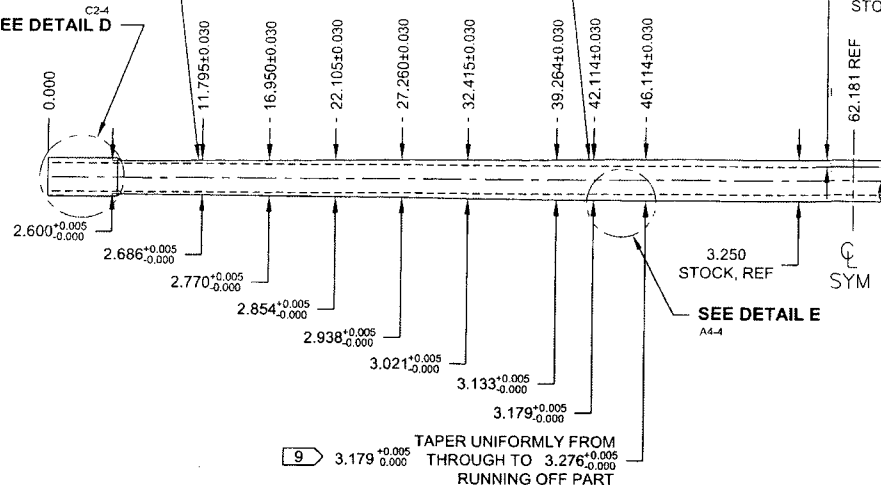

9  
30° X 0.500 DEEP  
CHAMFER

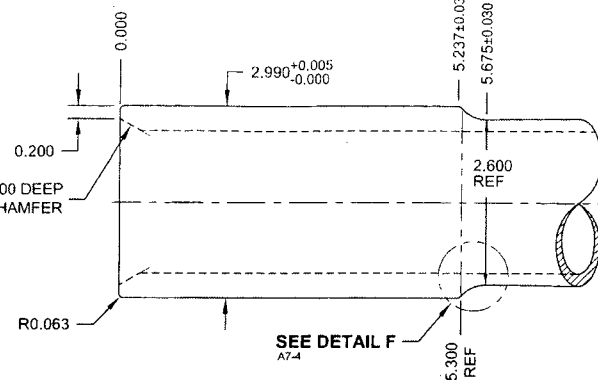

DETAIL D:  
CROSSTUBE CUFF D8-4  
SCALE 5X



100-11-614  
11.07.28

UNDER REVIEW  
9/1/08/13

DEO ATTACHED

RELEASED  
2009-10-29

D212-664-241TRN  
TURNING DETAIL

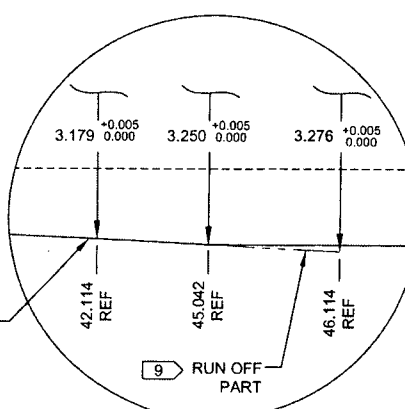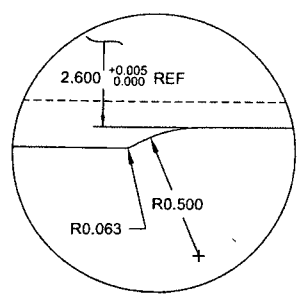

DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	P	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-241	SHEET 4 OF 4
APPROVED	AD	TITLE	SCALE
DE APPR.	TH	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. HAS IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			



99735

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			

**PURPOSE:**

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

**CHANGE:**

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND  
PAINT OUTSIDE PER DART QSI 005 4.2  
REMOVE MASKING AND APPLY CLEAR COAT

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2

**RELEASED**  
2011-04-18

**UNDER REVIEW**

11.06.13

ECU-11-614

11.07.28






99235

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>	D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>E</i>	APPROVED <i>MD</i>	DE APPR. <i>MD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		


IS:

WAS:

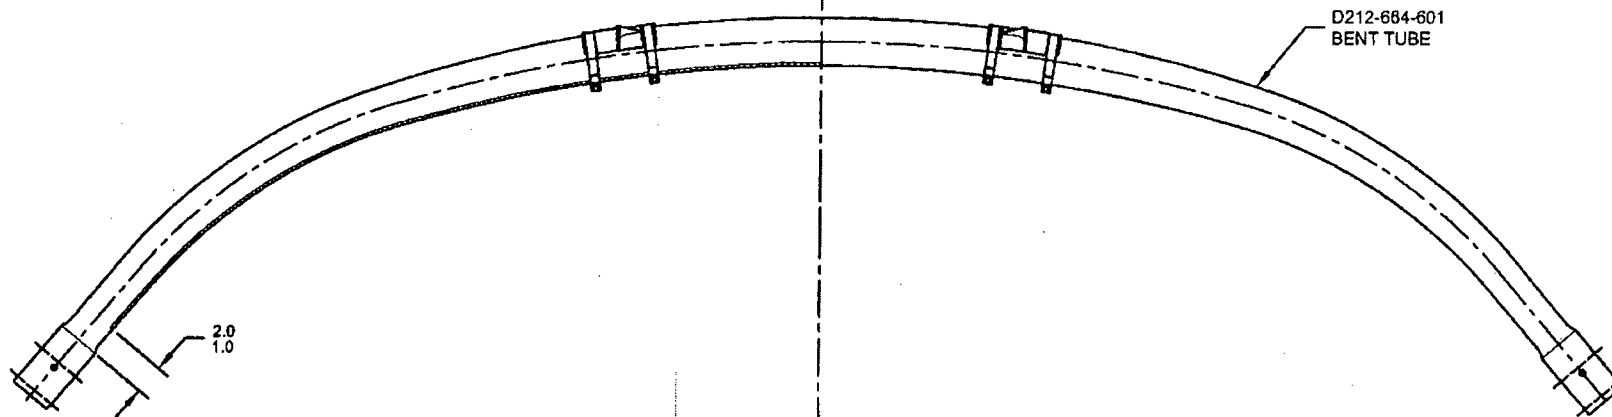

**D212-664-241-241B  
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING,  
REMOVE MASKING AFTER PAINT  
AND APPLY CLEAR COAT

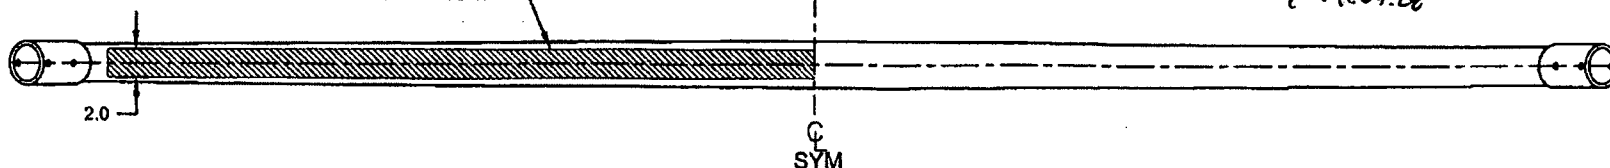

**RELEASED**  
2011-04-18

**UNDER REVIEW**

*CP* 11.06.13  
11.06.13  
11.07.28



99235

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	REV. D	<b>DART AEROSPACE LTD ENGINEERING ORDER</b>	D.E.O. NO. D212-664-241-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN 92	CHECKED ASS	MFG. APPR. [Signature]	APPROVED [Signature]	DE APPR. [Signature]		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/27/21	DATE 11.07.21		

**PURPOSE:**

REPLACE MAGNOBOND WITH PROSEAL.

**CHANGE:**

IS:

Item	Qty -241	Qty -241B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2940-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED  
2011-07-28  
[Signature]

